Accessibility Survey

Americans with Disabilities Act And Title 24 of the California Building Code



Prepared By

Disability Access Consultants, Inc. (800) 743-7067



City of Glendale

Montrose Parking Lot #2

Honolulu Avenue

Inspected January 2008

Facility Name: Montrose Parking Lot #2

Programs, Services, and Activities

Finding: Parking Lot #2 is located at the intersection of Honolulu

Avenue and Wickham Way in Glendale, California. The parking lot was inspected by Disability Access

Consultants, Inc., on January 17, 2008.

Alternative * Rec: (Where Available)

Full Rec: Any renovation or new construction that occurred after

January 26, 1992, is subject to meet full code specifications for the California Building Code and ADAAG requirements. All recommendations in this report are based on ADAAG and CBC Title 24 requirements. Consult with your design professional to determine which elements are affected by these requirements. It is recommended that Disability Access Consultants, Inc. is consulted for inspection of any new construction or renovation at the facility.

Citations:

Minimum Quantity: Maximum Quantity **Minimum Estimated Cost:** \$0.00 **Maximum Estimated Cost:** \$0.00

> Record Number:: 131

Priority:

Parking

Finding: There are 3 accessible parking spaces out of 69 parking spaces which meets the minimum number for compliance. The accessible parking spaces do not measure at least 108 inches wide and 216 inches long. There is no "van-accessible" parking space and the access aisles does not contain "NO PARKING" in 12" high white letters.

Alternative * Rec: (Where Available)



Full Rec: Restripe the existing accessible spaces so each

measures at least 108 inches wide and 216 inches long. Designate one parking space as "vanaccessible". The van-accessible space shall provide a 96 inch wide passenger side access aisle. Add the words NO PARKING in 12 inch high white letters at the entrance to each accessible parking access aisle.

Accessible Parking Citations: CBC 1129B; ADAAG 4.6; ADAAG A4.6

Minimum Quantity: 1 Maximum Quantity 3 \$270.00 **Minimum Estimated Cost: Maximum Estimated Cost:** \$810.00 Record Number:: 132

Facility Name: Montrose Parking Lot #2

Parking

Finding: There is no accessible route between the accessible

parking spaces and the public right of way. The accessible spaces require travel behind vehicles other

than the wheelchair users space.

Alternative *
Rec:
(Where
Available)

Full Rec: Install a compliant path of travel from the sidewalk

(public right of way) to the accessible parking spaces. Wheelchair users must not be forced to go behind

parked cars other than their own.



Accessible Parking

Citations: CBC 1129B.4.3; ADAAG 4.7.1

Minimum Quantity:1Maximum Quantity3Minimum Estimated Cost:\$1,033.00Maximum Estimated Cost:\$3,099.00

Record Number:: 133

Priority:

Parking

Finding: The surface of the accessible parking spaces has

slopes greater than 2%.

Alternative *
Rec:
(Where
Available)

Full Rec: Pave the parking lot at the accessible spaces to provide a level surface. Parking surfaces and access aisles

shall be located in areas not exceeding a 2% slope in all directions (see CBC 1129B and ADAAG 4.6.3).



Accessible Parking

Citations: CBC 1129B; ADAAG 4.6.3

Minimum Quantity:1Maximum Quantity3Minimum Estimated Cost:\$900.00Maximum Estimated Cost:\$2,700.00

Record Number:: 134

Priority:

Facility Name: Montrose Parking Lot #2

Parking

Finding: There is no warning signage posted at the entrance

from Honolulu Avenue regarding unauthorized use of accessible parking spaces in the parking lot.

Alternative * Rec: (Where Available)

Full Rec: Post a sign in a conspicuous place at the entrance of the parking lot, or immediately adjacent to and visible from each accessible space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities may be towed away at owner's expense. Towed vehicles may be reclaimed at or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and be sure to add the CVC 22511.8(a)(d) to the sign.



Accessible Parking

Citations: CBC 1129B.5; ADAAG 4.6.4 CVC 22511.8(a)(d)

Minimum Quantity: Maximum Quantity 2 **Minimum Estimated Cost:** \$150.00 **Maximum Estimated Cost:** \$300.00

Record Number:: 135

Priority:

Parking

Finding: There is vertically-mounted signage at the accessible parking spaces, however, the signs use the word "Handicapped".

Alternative * Rec: (Where Available)

Full Rec: Install a permanently posted reflectorized sign measuring 70 square inches that includes an ISA symbol adjacent to and visible from the accessible parking space (see CBC 1129B.5). The bottom edge of the sign must be mounted 80 inches from the ground surface so that it cannot be obscured by a parked vehicle (see CBC 1129B.5). The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign (see CBC 1129B.5 and ADAAG 4.6.4). Do not use the word "Handicapped" on signage.



Accessible Parking

Citations: CBC 1129B.5; ADAAG 4.6.4

Minimum Quantity: 1 Maximum Quantity 3 \$150.00 **Minimum Estimated Cost: Maximum Estimated Cost:** \$450.00 Record Number:: 137

Priority:


Facility Name: Montrose Parking Lot #2

Path of Travel

Finding: There is no accessible route from the public right of way

to the parking lot or to the accessible parking spaces.

Alternative *
Rec:
(Where
Available)

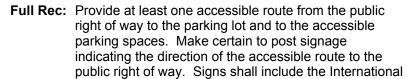

Symbol of Accessibility.



Accessible Route from the Public Right of Way

Citations: CBC 1114B.1.2; CBC 1117B.5.7; CBC 1127B.3; ADAAG 4.1.2(7); ADAAG 4.3.2; ADAAG 4.14.1

Minimum Quantity:

Maximum Quantity

Minimum Estimated Cost: \$107.00

Maximum Estimated Cost: \$0.00

Record Number:: 136

3

Priority: