Accessibility Survey

Americans with Disabilities Act And Title 24 of the California Building Code



Prepared By

Disability Access Consultants, Inc. (800) 743-7067



City of Glendale

College Parking Lot #34

1726 Cañada Boulevard

Inspected January 2008

Programs, Services, and Activities

Finding: Parking Lot #34 is located at 1401 North Verdugo Road

in Glendale, California. The parking lot was inspected by Disability Access Consultants, Inc., on January 16, 2008.

Alternative * Rec: (Where Available)

Full Rec: Any renovation or new construction that occurred after

January 26, 1992, is subject to meet full code specifications for the California Building Code and ADAAG requirements. All recommendations in this report are based on ADAAG and CBC Title 24 requirements. Consult with your design professional to determine which elements are affected by these requirements. It is recommended that Disability Access Consultants, Inc. is consulted for inspection of any new construction or renovation at the facility.

Citations: ADAAG 4.1.2; ADAAG 4.1.3; ADAAG 4.1.5; ADAAG 4.1.6

Minimum Quantity: Maximum Quantity **Minimum Estimated Cost:** \$0.00 **Maximum Estimated Cost:** \$0.00 Record Number:: 32

Priority:

Parking

Finding: There is 1 accessible parking space out of 218 parking spaces which does not meet the minimum number for compliance. There is no "van-accessible" parking space and the access aisle does not contain "NO PARKING" in 12" high white letters.

Alternative * Rec: (Where Available)



Full Rec: Seven out of the 218 total number of marked parking spaces are required to be designated exclusively for accessible parking. Create six additional accessible spaces including a van-accessible space with a 96 inch wide passenger side access aisle. Each additional space shall have a 60 inch access aisle that may be shared. Add the words NO PARKING in 12 inch high white letters at the entrance to each accessible parking access aisle.

Citations: CBC 1129B; ADAAG 4.6; ADAAG A4.6

Minimum Quantity: 1 7 Maximum Quantity **Minimum Estimated Cost:** \$270.00 **Maximum Estimated Cost:** \$1,890.00 Record Number::

Priority:

Facility Name: College Parking Lot #34

Parking

Finding: There is no accessible route between the accessible

parking space and the public right of way.

Alternative *
Rec:
(Where
Available)

Full Rec: Install a compliant path of travel from the sidewalk (public right of way) to each accessible parking space.

Wheelchair users must not be forced to go behind

parked cars other than their own.



Accessible Parking

Citations: CBC 1129B.4.3; ADAAG 4.7.1

Minimum Quantity:

Maximum Quantity

Minimum Estimated Cost: \$1,033.00

Maximum Estimated Cost: \$1,033.00

Record Number:: 34

Priority:

Parking

Finding: The surface of the accessible parking spaces has

slopes greater than 2%.

Alternative *
Rec:
(Where
Available)

Full Rec: Pave the parking lot at the accessible spaces to provide a level surface. Parking surfaces and access aisles

shall be located in areas not exceeding 2% slope in all directions (see CBC 1129B and ADAAG 4.6.3).



Accessible Parking

Citations: CBC 1129B; ADAAG 4.6.3

Minimum Quantity: 1
Maximum Quantity 1
Minimum Estimated Cost: \$900.00
Maximum Estimated Cost: \$900.00

Record Number:: 35

Priority:

Parking

Finding: There is no warning signage posted at the entrance

from North Orange Street regarding unauthorized use of

accessible parking spaces in the parking lot.

Alternative * Rec: (Where Available)

Full Rec: Post a sign in a conspicuous place at the entrance of the parking lot, or immediately adjacent to and visible from each accessible space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities may be towed away at owner's expense. Towed vehicles may be reclaimed at or by telephoning ____ ." Fill in the blank spaces with appropriate information as a permanent part of the sign and be sure to add the CVC 22511.8(a)(d) to the sign.



Accessible Parking

Citations: CBC 1129B.5; ADAAG 4.6.4 CVC 22511.8(a)(d)

Minimum Quantity: Maximum Quantity **Minimum Estimated Cost:** \$150.00 **Maximum Estimated Cost:** \$150.00

Record Number:: 36

Priority:

Parking

Finding: There is vertically-mounted signage at the accessible parking spaces, however, the signs use the word "Handicapped".

Alternative * Rec: (Where Available)

Full Rec: Install a permanently posted reflectorized sign measuring 70 square inches that includes an ISA symbol adjacent to and visible from the accessible parking space (see CBC 1129B.5). The bottom edge of the sign must be mounted 80 inches from the ground surface so that it cannot be obscured by a parked vehicle (see CBC 1129B.5). The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign (see CBC 1129B.5 and ADAAG 4.6.4). Do not use the word "Handicapped" on signage.



Accessible Parking

Citations: CBC 1129B.5; ADAAG 4.6.4

Minimum Quantity: 1 Maximum Quantity \$150.00 **Minimum Estimated Cost: Maximum Estimated Cost:** \$150.00

Record Number::

Priority:

38

Facility Name: College Parking Lot #34

Parking

Finding: The vertical clearance at the accessible parking space

is less than 98 inches due to overhanging tree branches.

Alternative * Rec: (Where Available)

Full Rec: Maintain the tree branches to provide at least 98

inches of vertical clearance at the accessible parking

space.



Accessible Parking

Citations: ADAAG 4.6.5

Minimum Quantity: Maximum Quantity **Minimum Estimated Cost:** \$0.00 **Maximum Estimated Cost:** \$0.00

> Record Number:: 39

Priority:

Path of Travel

Finding: There is no accessible route from the public right of way


to the parking lot or to the accessible parking space.

Alternative * Rec: (Where Available)

Full Rec: Provide at least one accessible route from the public

right of way to the parking lot and to the accessible parking spaces. Make certain to post signage indicating the direction of the accessible route to the public right of way. Signs shall include the International

Symbol of Accessibility.

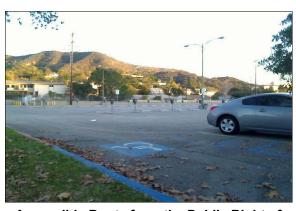

Accessible Route from the Public Right of Way

Citations: CBC 1114B.1.2; CBC 1117B.5.7; CBC 1127B.3; ADAAG 4.1.2(7); ADAAG 4.3.2; ADAAG 4.14.1

Minimum Quantity: Maximum Quantity **Minimum Estimated Cost:** \$107.00 **Maximum Estimated Cost:**

> Record Number:: 37

Priority:

\$0.00